
[Obsolete product] Agilent has a new name Keysight Technologies.

Keysight Technologies Inc. is the world's leading electronic measurement company, transforming today's measurement experience through innovations in wireless, modular, and software solutions. With its HP and Agilent legacy, Keysight delivers solutions in wireless communications, aerospace and defense and semiconductor markets with world-class platforms, software and consistent measurement science.

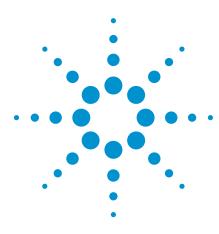

Key features

Check more, fix more

- 10,000-count display
- 0.09% basic DCV accuracy
- True RMS AC measurement
- Basic functions ACV, DCV, ACI, DCI, resistance, frequency, diode, continuity tests
- Advanced functions Capacitance, temperature, MINMAX recording

Ease of use

- Adjustable backlighting two intensity levels
- Manual data logging (U1242B only)
- · Built-in switch counter. harmonic ratio (U1242B only), dual/differential temperature capabilities (U1242B only)

Built to last

- Overmold body casing
- CAT III 1000 V and CAT IV 600 V safety protection
- · Certified to CE and CSA standards
- Operating temperature: -10 to 55 °C

Agilent U1240 Series Handheld **Digital Multimeters**

Helping You Check and Fix More Installation and Maintenance Bugs

Data Sheet

The Agilent U1240 Series handheld digital multimeters enable you to check more with wider measurement ranges. They feature true RMS readings on their 10,000-count displays. The adjustable backlighting allows you to complete your jobs even in subdued lighting conditions, or to simply prolong battery life. Your maintenance tasks are greatly simplified due to the built-in switch counter, harmonic ratio, dual and differential temperature capabilities, with just a press of the button. The meters have a high safety rating with CAT III 1000 V and CAT IV 600 V protection and are certified to CE and CSA standards. On top of that, the U1240 Series comes with a certificate of calibration and test report at no extra cost.

The latest multimeters in this series, the U1241B and U1242B, now come in vivid orange cases, offering the capabilities and functions you need.

Functions and ranges at a glance



0.1 nF to 10 mF ACµA: 0.1 µA to 10 mA Frequency: 1 Hz to 200 kHz Manual Data Logging (U1242B only) ACmA: 0.01 to 1000 mA

ACA: 0.01 to 10 A

Temperature: -40 to 1000 °C



Agilent Technologies

DC specifications

			Test current/	Accuracy ± (% of reading + counts of least significant digit)	
Function	Range	Resolution	burden voltage	U1241B	U1242B
	1000.0 mV	0.1 mV	-		0.09% + 5
Valtaral	10.000 V	0.001 V	_	0.09% + 2	
Voltage ¹	100.00 V	0.01 V	_		
	1000.0 V	0.1 V	_		0.15% + 5
	1000.0 μA	0.1 µA	< 0.06 V (50 Ω)	0.1% + 3	
	10000 µA	1 µA	< 0.55 V (50 Ω)	0.1% + 3	
Current	100.00 mA	0.01 mA	< 0.18 V (0.5 Ω)	0.2% + 3	
	440.0 mA ²	0.1 mA	< 0.8 V (0.5 Ω)		0.5% + 3
	10.000 A ³	0.001 A	< 0.4 V (0.01 Ω)		0.6% + 5
	1000.0 Ω ⁵	0.1 Ω	0.5 mA	0.3% + 3	
	10.000 kΩ ⁵	0.001 kΩ	50 µA		
Desistance	100.00 kΩ	0.01 kΩ	4.91 µA		
Resistance ⁴	1000.0 kΩ	0.1 kΩ	447 nA		
	10.000 MΩ	0.001 MΩ	112 nA		0.8% + 3
	100.00 MΩ ⁶	0.01 MΩ	112 nA		1.5% + 3
Diode test ⁷	1 V	0.001 V	approximately 0.5 mA		0.3% + 2

1. Input impedance: 10 MΩ (nominal).

 Current can be measured up to 440 mA continuously. An additional 0.2% needs to be added to the specified accuracy if the signal measured is in the range of 440 mA to 1100 mA for 30 seconds maximum. After measuring a current of > 440 mA, leave the meter to cool down for twice the measuring time used before applying a low current measurement.

3. Current can be measured up to 10 A continuously with a maximum operating temperature of 50 °C. An additional 0.3% needs to be added to the specified accuracy if the signal measured is in the range of 10 A to 19.999 A for 15 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for 60 seconds before applying a low current measurement.

4. The maximum open voltage is < 2.8 V. For instant continuity, the built-in buzzer sounds when resistance is < 10.0 Ω .

5. The accuracy of 1 k Ω and 10 k Ω is specified after Null function, which is used to substrate the test lead resistance and the thermal effect.

6. For the range of 100 M Ω , the R.H. is specified for < 60%. The temperature coefficient will be 0.15 times of specified accuracy as > 50 M Ω .

7. Overload protection: 1000 V RMS for circuits < 0.3 A short circuit current. The built-in buzzer sounds when reading is approximately below 50 mV and audible single tone for normal forward biased diode or semiconductor junction as 0.3 V ≤ Reading ≤ 0.8 V.

AC specifications

			Test current/	Accuracy ± (% of reading + counts of least significant digit)		
Function	Range	Resolution	burden voltage	40 to 500 Hz	500 Hz to 1 kHz	1 to 2 kHz
	1000.0 mV	0.1 mV	-	 1% + 5	2% + 5	-
AC voltage ^{8, 12}	10.000 V	0.001 V	-		1% + 5	2% + 5
True RMS	100.00 V	0.01 V	-			
	1000.0 V	0.1 V	-			_
	1000.0 µA	0.1 µA	< 0.06 V (50 Ω)	1% + 5	1.5% + 5	
	10000 µA	1 µA	< 0.55 V (50 Ω)			
AC current ^{9, 12} True RMS	100.00 mA	0.01 mA	< 0.18 V (0.5 Ω)			-
	440.0 mA ¹⁰	0.1 mA	< 0.8 V (0.5 Ω)			
	10.000 A ¹¹	0.001 A	< 0.4 V (0.01 Ω)			

8. Input impedance: 10 M Ω (nominal) in parallel with < 100 pF, with overload protection of 1000 V RMS

9. Crest factor ≤ 3. For non-sinusoidal waveforms with crest factor up to 3, add 2% reading + 2% full scale typical.

10. Current can be measured from 50 mA to 440 mA continuously. An additional 0.2% needs to be added to the specified accuracy if the signal measured is in the range of 440 mA to 1100 mA for 30 seconds maximum. After measuring a current of > 440 mA, leave the meter to cool down for twice the measuring time used before application of low current measurement.

11. Current can be measured from 0.5 A up to 10 A continuously with a maximum operating temperature of 50 °C. An additional 0.3% needs to be added to the specified accuracy if the signal measured is in the range of 10 A to 19.999 A for 15 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for 60 seconds before applying a low current measurement.

12. AC voltage and AC current specifications are AC coupled. True RMS measurement is valid from 5 % of range to 100 % of range.

Temperature specifications

Thermocouple type	Range	Resolution	Accuracy ± (% of reading + offset error)
K (for U1241B and U1242B)	–40 to 1000 °C/–48 to 1832 °F	0.1 °C /0.1 °F	1% + 1 °C/1% + 1.8 °F
J (for U1242B only)	-40 to 1000 °C/-48 to 1832 °F	0.1 °C/0.1 °F	1% + 1 °C/1% + 1.8 °F

Capacitance specifications

Range	Resolution	Accuracy ± (% of reading + counts of least significant digit)	
1000.0 nF	0.1 nF		
10.000 µF	0.001 µF	1.2% + 4	
100.00 µF	0.01 µF		
1000.0 µF	0.1 µF	2% + 4	
10.000 mF	0.001 mF		

Harmonic ratio specifications

Range	Frequency	Voltage
0.0% to 99.9%	40 to 500 Hz	100 mVAC to 1000 VAC

Switch counter definition

Switch condition ^{1, 2}	Circuit switch	Display ³	Switch threshold
Low level	Normally close	Lo	< 370 ohms
Intermittent ⁴	Close to open	Number of switch count	Low to high transition
High level	Normally open	Hi	> 430 ohms
Intermittent ⁵	Open to close	Number of switch count	High to low transition

1. Detects intermittent Opens or Closes lasting for at least 250 µsec.

2. Test current of 0.5 mA with maximum open circuit voltage of 2.8 V is used.

3. Maximum count reading: 199.99 M (display "OL" when achieving 2 x 10⁸ and thereafter).

4. Count only low to high transition for initial switch condition of Low.

5. Count only high to low transition for initial switch condition of High.

Frequency specifications

1 Hz

1. Effective frequency measurement of up to 200 kHz; refer to frequency sensitivity table below for details.

Frequency sensitivity during voltage measurement

Input range (Maximum input for specified accuracy =	Minimum sensitivity (RMS sine wave)		
10 x Range or 1000 V)	20 Hz to 50 kHz	50 to 200 kHz	
1000.0 mV	0.3 V	0.6 V	
10.000 V	0.5 V	1.8 V	
100.00 V	5 V	10 V (< 100 kHz)	
1000.0 V	50 V	100 V (< 100 kHz)	

Frequency sensitivity during current measurement

	Minimum sensitivity (RMS sine wave	
Input range	20 Hz to 20 kHz	
1000.0 μA	100 µA	
10000 µA	500 µA	
100.00 mA	10 mA	
440.00 mA	50 mA	
10.000 A	1 A	

Measuring rate

Function	Times/second
ACV	7
DCV (V or mV)	7
Ω	14
Diode	14
Capacitance	4 (< 100 μF)
DCA (µA, mA, A)	7
ACA (µA, mA, A)	7
Temperature	7 (single)
Frequency	1 (> 10 Hz)

General Specifications

Display	Dual display (secondary display is intended for temperature function display only) consists of 4-digit liquid crystal display (LCD) with maximum reading of 11,000 counts. Automatic polarity indication.
Power consumption	0.22 VA maximum
Battery type and life	Four single standard 1.5 V AAA batteries (Alkaline or Zinc Chloride type); 300 hours typical
Operating environment	 Full accuracy at -10 to 55 °C; and to 80% RH for temperatures up to 30 °C, decreasing linearly to 50% RH at 55 °C 0 - 2000 meters per IEC 61010-1 2nd Edition CAT III, 1000 V / CAT IV, 600 V IEC 61010-1 2nd Edition
Storage compliance	–20 to 70 °C
Safety compliance	 IEC 61010-1:2001 / EN61010-1:2001 Canada: CSA C22.2 No. 61010-1:2004
Measurement category	CAT III 1000 V / CAT IV 600 V Overvoltage Protection, Pollution Degree 2
EMC compliance	 CISPR 11:1990/EN55011:1990 Canada: ICES-001:2004 Australia/New Zealand: AS/NZS CISPR11:2004
Common Mode Rejection Ratio (CMRR)	$>$ 90 dB at DC, 50/60 Hz \pm 0.1% (1 k Ω unbalanced)
Normal Mode Rejection Ration (NMRR)	> 60 dB at 50/60 Hz ± 0.1%
Crest factor	< 3.0
Temperature coefficient	0.1 \times (specified accuracy) / °C (from –10 to 18 °C or 28 to 55 °C)
Shock and vibration	Tested to IEC/EN 60068-2
Dimensions (H x W x D)	193.8 mm x 92.2 mm x 58.0 mm
Weight	 450 g with batteries 400 g without batteries
Warranty	Three years for main unitThree months for standard shipped accessories

Ordering Information



U1241B

U1242B

Standard shipped accessories

- Four 1.5 V AAA alkaline batteries
- Certificate of Calibration (CoC)
- Test probe leads (4-mm tips)
- Quick Start Guide
- Free test data (Option UK6)

Optional accessories Measuring accessories (non-temperature)

Measuring accessories (non-temperat	ure)
U1161A Extended test lead kit	Includes two test leads (red and black), two test probes, medium- sized alligator clips and 4-mm banana plugs. Test leads: CAT III 1000 V, CAT IV 600 V, 15 A Test probes: CAT III 1000 V, CAT IV 600 V, 15 A Medium-sized alligator clips: CAT III 1000 V, CAT IV 600 V, 15 A 4-mm banana plugs: CAT II 600 V, 10 A
U1162A Alligator clips	 One pair of insulated alligator clips (red and black). Recommended for use with Agilent standard test leads. Rated CAT III 1000 V, CAT IV 600 V, 15 A
U1163A SMT grabbers	 One pair of SMT grabbers (red and black). Recommended for use with Agilent standard test leads. Rated CAT II 300 V, 3 A
U1164A Fine-tip test probes	 One pair of fine-tip test probes (red and black). Recommended for use with Agilent standard test leads. Rated CAT II 300 V, 3 A
U1168A Standard test lead kit	 Includes two test leads (red and black), 19-mm and 4-mm test probes, alligator clips, fine-tip test probes, SMT grabbers and mini grabber (black). Test leads: CAT III 1000 V, CAT IV 600 V, 15 A Test probes (19-mm tip): CAT II 1000 V, CAT IV 600 V, 15 A Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A Gating the clips: CAT III 1000 V, CAT IV 600 V, 15 A Fine-tip test probes: CAT III 1000 V, CAT IV 600 V, 15 A SMT grabber: CAT II 300 V, 3 A Mini grabber: CAT II 300 V, 3 A
U1169A Test probe leads	 Includes two test leads (red and black), and a pair each of 19-mm and 4-mm test probes. Test leads: CAT III 1000 V, CAT IV 600 V, 15 A Test probes (19-mm tip): CAT II 1000 V, 15 A Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A (highly recommended for CAT IV environment)
U1583B AC current clamp	 Dual range: 40 A and 400 A Rated CAT III 600 V BNC-to-banana-plug adapter provided for use with DMMs

Ordering Information

Optional accessories		
Measuring accessories (temperature)		
U1180A Thermocouple adapter+lead kit, J and K types	 Includes thermocouple adapter, thermocouple bead J-type and thermocouple bead K-type. T/C adapter J/K-type T/C bead J-type: -20 °C to 200 °C T/C bead K-type: -20 °C to 200 °C 	
U1181A Immersion temperature probe	 Type-K T/C for use in oil and other liquids Measurement range: -50 °C to 700 °C Includes adapter U1184A for connection to DMM 	
U1182A Industrial surface temperature probe	 Type-K T/C for use on still surfaces Measurement range: -50 °C to 400 °C Includes adapter U1184A for connection to DMM 	
U1183A Air temperature probe	 Type-K T/C for use in air and non-caustic gas Measurement range: -50 °C to 800 °C Includes adapter U1184A for connection to DMM 	
U1184A Temperature probe adapter	Mini-connector-to-banana-plug adapter for use with DMM	
U1185A J-type thermocouple and adapter	 T/C adapter J/K-type T/C bead J-type: -20 °C to 200 °C 	
U1186A K-type thermocouple and adapter	 T/C adapter J/K-type T/C bead J-type: -20 °C to 200 °C 	
Carrying case		
U1172A Transit case (aluminium-clad)	 The robust casing to transport your DMM and accessories Aluminum-clad, black panel construction Dimension: 18 inches (H) x 13 inches (W) x 6 inches (D) Weight: 4 kg 	
U1174A Soft carrying case	The convenient way to carry your DMM and essential accessories • Dimension: 9 inches (H) x 5 inches (W) x 3 inches (D)	
Hanging kit		
U1171A Magnetic hanging kit	For fastening the DMM to a steel surface so both hands are free	
U1179A IR Connectivity Bracke	Connect with U1177A IR-to-Bluetooth adapter or U1173A IR-USB cable	

Agilent Email Updates

www.agilent.com/find/emailupdates Get the latest information on the products and applications you select.

AXIe

www.axiestandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.

LXI

www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based highperformance measurement and automation system.

Agilent Channel Partners

www.agilent.com/find/channelpartners Get the best of both worlds: Agilent's measurement expertise and product

breadth, combined with channel partner convenience.



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com/quality

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/handhelddmm

www.agilent.com/find/contactus

Americas

www.agilent.com

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40	
Denmark	45 45 80 12 15	
Finland	358 (0) 10 855 2100	
France	0825 010 700*	
	*0.125 €/minute	
Germany	49 (0) 7031 464 6333	
Ireland	1890 924 204	
Israel	972-3-9288-504/544	
Italy	39 02 92 60 8484	
Netherlands	31 (0) 20 547 2111	
Spain	34 (91) 631 3300	
Sweden	0200-88 22 55	
United Kingdom	44 (0) 118 927 6201	

For other unlisted countries: www.agilent.com/find/contactus Revised: January 6, 2012

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2012 Published in USA, March 1, 2012 5989-7040EN

