## Application-Specific Information

Motorola Part Numbers Affected: XPC604RRX266LD XPC604RRX300LD XPC604RRX333LD

# PowerPC 604e™ RISC Microprocessor Family: PIDAq-604e and PID9q-604e (Mach5) Part Number Specifications

This document defines a unique part number for a PowerPC 604e microprocessor manufactured by Motorola. It describes changes to recommended operating conditions and revised electrical specifications, as applicable, from those described in the *PowerPC 604e RISC Microprocessor Family: PID9q-Mach5 Hardware Specifications*. Any functional differences (errata) for these parts from the functional description provided in the *PowerPC*<sup>TM</sup> 604 RISC Microprocessor User's Manual (order # MPC604UM/AD) or its addendum (order # MPC604UMAD/AD) are described in a separate Errata List available from your local Motorola sales office.

Specifications provided in this data sheet supercede those in 4/97 Revision of the PID9q-Mach5 Hardware Specifications (order #: MPC604E9QEC/D); specifications not addressed herein are unchanged. This document is frequently updated; refer to the website at http://www.mot.com/SPS/PowerPC/ for the latest version.

Note that headings and tables in this data sheet are not numbered; however, they are intended to correspond directly to the heading or table affected in the general hardware specifications. Any additional information (including tables) not included in the hardware specifications are noted.

Part numbers addressed in this document and a summary of their differences from the general specification are listed in the following table. For more detailed ordering infomation see "Ordering Information for the PB-604e Microprocessor" on page 2.

#### Operating Conditions **Motorola Part** Significant Differences from Hardware **CPU** Specification Number T<sub>J</sub> (°C) Vdd Frequency XPC604RRX266LD 266 MHz 1.80 to 2.00V 0 to 85 New PVR.; BTAC Disabled XPC604RRX300LD 300 MHz 1.80 to 2.00V 0 to 85 New PVR; BTAC Disabled

1.80 to 2.00V

### Part Numbers Addressed by this Data Sheet

Note: The X prefix in a Motorola PowerPC part number designates a "Pilot Production Prototype" as defined by Motorola SOP 3-13. These are from a limited production volume of prototypes manufactured, tested and Q.A. inspected on a qualified technology to simulate normal production. These parts have only preliminary reliability and characterization data. Before pilot production prototypes may be shipped, written authorization from the customer must be on file in the applicable sales office acknowledging the qualification status and the fact that product changes may still occur while shipping pilot production prototypes.

0 to 85

New PVR; BTAC Disabled

### **Feature Changes**

XPC604RRX333LD

This section summarizes significant feature changes between the revision of the PID9q-604e addressed by this document and the previously available revision 1.01 (XPC604RRXnnnPB where nnn is the CPU frequency) and revision 1.1 (XPC604RRXnnnPC).

• Errata #7 from these earlier revisions is corrected on revision 1.2.

333 MHz

The following features are significantly different from the feature set described in the *PowerPC 604 RISC Microprocessor User's Manual* (order # MPC604UM/AD) or its addendum (order # MPC604UMAD/AD). While they are unchanged from revisions 1.01 and 1.1, they bear repeating here.

 In-system testability and debugging features through JTAG boundary-scan capability is not guaranteed in these part revisions.

The PowerPC name, the PowerPC logotype, and PowerPC 604e are trademarks of International Business Machines Corporation used by Motorola under license from International Business Machines Corporation.

This document contains information on a new product under development by Motorola. Motorola reserves the right to change or discontinue this product without notice.

© Motorola Inc. 1998. All rights reserved.



- register (PVR) contents. This These part revisions will have different processor v read-only register that identifies the version (model) and revision level of owerPC processor. The proces h is 0x000a for revision 1.01 parts and is 0x0009 for revision 1.1 and revision 2 parts. The processor revise or revision 1.01 is 0x0101 and for revision 1.1 is 0x2110 and for revision 1.2 is 0x This change was made re compatibility with other members of the 604e family of microprocessors.
- The revision 1.1 and revision 1.2 parts have the Branch 7 Address Cache (I abled.

#### **Ordering Information**

art numbers described herein. The following table provides the ordering information for the unique


#### Ordering Information for the PB-6 licroprocessor

Package Type	Device Rev	Process	Mask Code	CPU C	y Motorola Part Number*
255	1.2	HIP4.0	74H76K	250 MHz	PC604RRX250LD
CBGA				300 MHz	RRX300LD
				333 MHz	XX333LD

Note: Per 604E-PE Part Number Specifications

## **Part Marking**

This section provides information on Motorola device marking. Parts are marked as shown below.

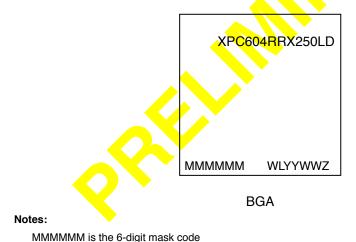

#### **Motorola Part Marking for BGA Devices**

Information in this document is provided solely to enable system and software implementers to use PowerPC microprocessors. There are no express or implied copyright licenses granted hereunder to design or fabricate PowerPC integrated circuits or integrated circuits based on the information in this document.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters can and do vary in different applications. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights not their others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized applications, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part.

Motorola and Motorola was negligent regarding the design or manufacture of the part.

Motorola and Motorola and Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

IBM is a registered trademark of International Business Machines Corporation.

WLYYWWZ is the traceability code

