-	
p.	1/5
1.	1/J

Spec No.	SS-020	
Data	Oct 30, 2003	
Version	First	


SPECIFICATION

Product name :Rodan Spark Gap

Type : RSG-801-BJL



OKAYA ELECTRIC AMERICA, INC.

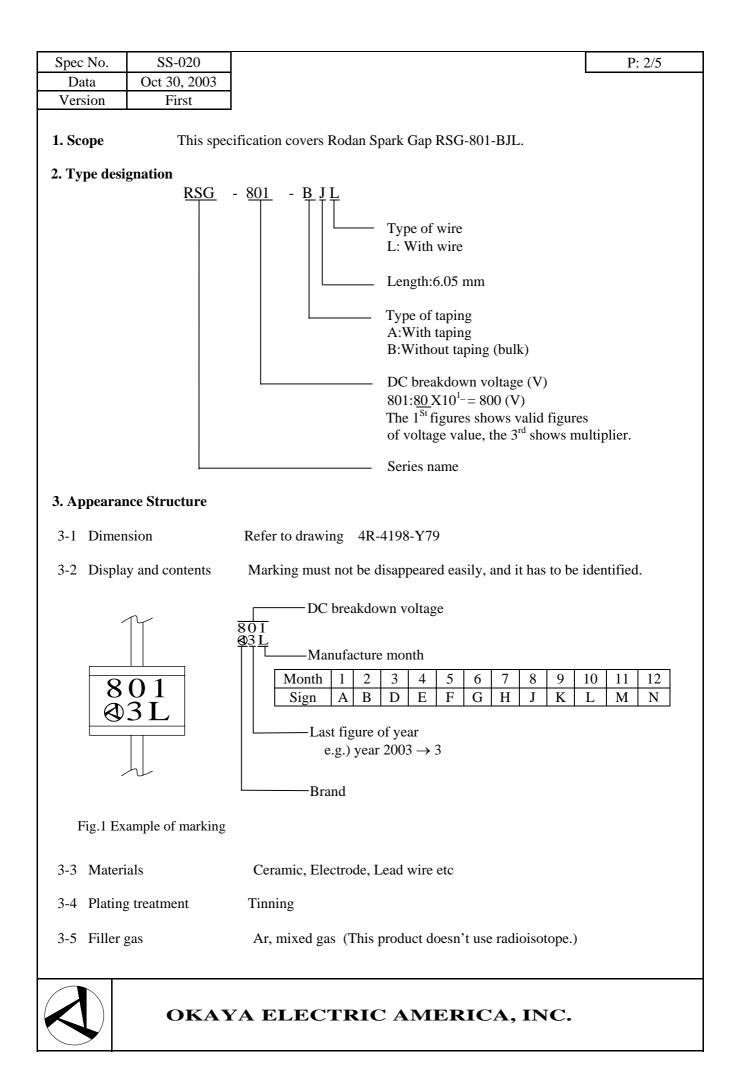

Spec No.	SS-020
Data	Oct 30, 2003
Version	First

4. Electrical characteristics

No.	Item	Mark	Test condition		Standard values
		Switching times	1 s Max		
		Ambient temperature	Room temperature		
			Test circuit		
1 DC breakdown Ez voltage	$R=300 \text{ k}\Omega \qquad L=0.5\mu\text{H}$ $V_0=1000 \text{ V} \qquad C=0.022\mu \text{ F} \qquad Osc$		800 V ±15 %		
2	Insulation resistance	IR	DC100 V		1000 MΩ Min
3	Electrostatic capacitance	С	1.0 kHz		2.0 pF Max
	4 Life test -		Switching frequency	30Hz	
		Switching times	2.5 s ON / 57.5 s OFF	Initial breakdown	
		Ambient temperature	Room temperature	voltage 1000 V Max	
		Test circuit		Following breakdown	
4		_	\	$E = 0.7\mu H$ $= 75 \text{ nF}$ $* R \text{ is adjusted}$	voltage 800 V ± 15 % Insulation resistance 100 M Ω Min (DC100 V)
			Minimum number according to the a	r of switching is $2x10^5$ times, bove condition.	

*1 The above-mentioned electric characteristics are regulations of during darkness.

*2 This product may discharge less than 680 V that is lower limit of specification. This case is known as early ignition. Early ignition incidence is specified as maximum of 3 % by above test condition of section1 and section4.



OKAYA ELECTRIC AMERICA, INC.

Spec No.	SS-020
Data	Oct 30, 2003
Version	First

5. Switching frequency

Maximum switching frequency : 200 Hz

6. Operating condition

Operating temperature: -40C to +100C


7. Storage condition

Storage temperature: -40C to +100C

8. About forming

As regards forming of spark gap, please take distance more than 2mm from main body when you bend lead wire.

When performing a forming, please hold only lead wire and be careful not to give a stress on main body.

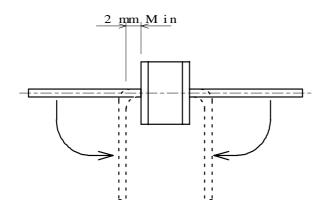




OKAYA ELECTRIC AMERICA, INC.

Spec No.	SS-020
Data	Oct 30, 2003
Version	First

9. Packing

Put 50 pcs. of RSG series and 1pc. of product label in a vinyl bag of specified size, seal the bag with a heatseal, put bags of quantity required a box, pack and stick product label on the box.

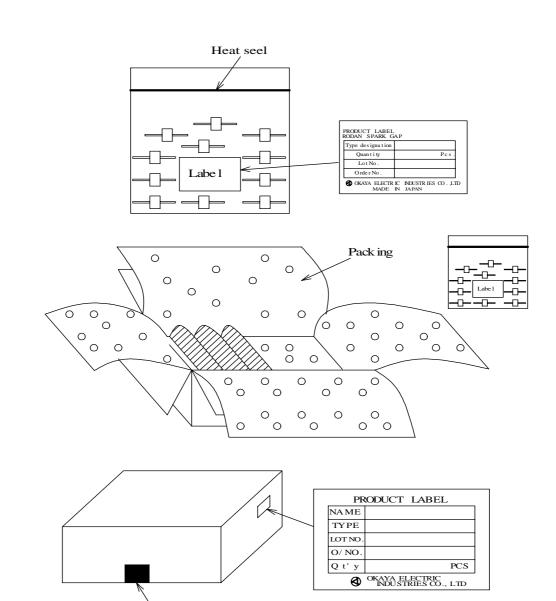

Tape

P: 5/5

