
Single head system



UC2000-F43-2KIR2-V17

Dimensions

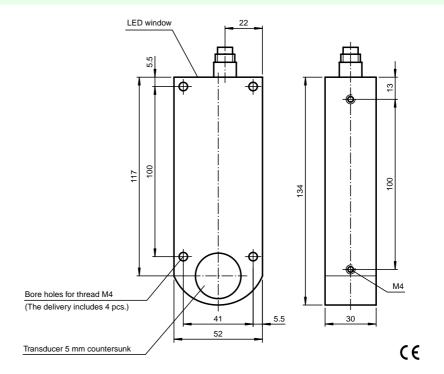

Features

- · Current output
- 2 Relays
- Serial Interfaces
- Temperature compensation
- Watchdog
- · Reverse polarity protection
- Parameterisable

Technical data

General specifications

Sensing range 100 ... 2000 mm
Standard target plate 100 mm x 100 mm
Unusable area 100 mm
Transducer frequency approx. 175 kHz

Response delay minimum (EM; NONE): ≤50 ms (2 measuring cycles)

factory setting (EM, MXN, 5, 2): ≤150 ms (6 measuring cycles)

dynamic (EM, DYN): ≤75 ms (3 measuring cycles)

EN 60947-5-2

Standard conformity Indicating/Operating means

LED green

Output Output type

Lifetime

Contact loading

Range hysteresis

Repeat accuracy

Load impedance

Resolution

LED red Electrical specifications

Rated operational voltage U_e

Power consumption P₀

continuous: object in the measuring window flashing: object outside the measuring window error (e. g. interference level too high)

10 ... 30 V DC without current output function 15 ... 30 V DC with current output function

Ripple ±10 %ss

≤ 2 W (all relays pulled-in, current output 20 mA)

no-load power consumption \leq 0.7 W

2 relay outputs, 1 analogue output 4 $\,\dots\,$ 20 mA 60 V DC / 1 A (max. 24 W DC), ohmic

electrical: 3 x 10⁵ operating cycles at ohm. Load

(1 A / 24 V DC)

mechanical: 10⁷ operating cycles 0 ... 15 % Parameterisable

< 0.1 %

≤ 0.1 % 0.5 mm

current output: ≤ 500 Ohm

< 0.2 % of final value

curve

Temperature influence Interface

Deviation of the characteristic

Interface type
Ambient conditions

Ambient temperature Storage temperature

Mechanical specifications

Protection degree Connection type Material Housing

Mass

≤ 2 %, internal temperature compensation

RS 232, 9600 bit/s, no parity, 8 data bits, 1 stop bit

-25 ... +70 °C (248 ... 343 K)

-40 ... +85 °C


IP65 according to EN 60529

8-pin round connector, Lumberg type RSF 8

PBT 290 g

Electrical connection

Standard symbol/Connection:




Thanks to its extensive command set, the sensor can be configured to suit the application via the RS 232 interface.

RS 232 command set (overview)			
Command	Meaning	Parameter	Access
VS0	Velocity of Sound at 0 °C	Velocity of sound at 0 °centigrade VS0 in [cm/s] {10000 60000)	read and set
VS	Velocity of Sound	Velocity of sound VS in [cm/s]	read
то	Temperature Offset	TO in [0.1K]	read and set
TEM	TEM perature	TEM in [0.1K]	read and
REF	·	. ,	adapt to TO
		REF distance in [mm] {100 4000}	adaptation of VS0
SD1	Switching Distance 1	Switching point, relay 1 SD1 in [mm] {100 4000}	read and set
SD2	Switching Distance 2	Switching point, relay 2 SD1 in [mm] {100 4000}	read and set
SH1	Switching Hysteresis 1	Hysteresis, relay 1 in [%] {0 15}	read and set
SH2	Switching Hysteresis 2	Hysteresis, relay 2 in [%] {0 15}	read and set
NDE	Near Distance of Evaluation	Near measuring window limit in [mm] {100 4000}	read and set
FDE	Far Distance of Evaluation	Far measuring window limit in [mm]{100 4000}	read and set
BR	Blind Range	Unusable area in [mm] {100 4000}	read and set
CBT	Constant Burst Time	Burst length in [µs] {0,1, 2, 3}	read and set
CCT	Constant Cycle Time	Time in [ms] {0 1000}	read and set
FTO	Filter TimeOut	Number of measurements without echo to be filtered {0 255}	read and set
EM	Evaluation Method	Evaluation method { 0 = NONE; PT1[,f,p,c]; MXN[,m,n]; DYN[,p] }	read and set
CON	CONservative filter	Counter threshold as number {0 255}	read and set
ОМ	Output Mode	OM coded [normally-open NO = 0, normally-closed NC = 1]	read and set
FSF	Fail Safe Function	Failure function type e.g. FSF,11,35 {0,1,2}, [fault current in 0.1 mA]	read and set
MD	Master Device	Function as master {0 = NONE},AD,RD,RT,SS,ADB,RDB,RTB}	read and set
MA	Main Application	Determines whether the green LED orients itself according to NDE, FDE or SD1 and SD2	read and set
NEF	No Echo Failure	Sensor behavior when no echo is present {0,1}	read and set
AD	Absolute Distance	Distance in [mm]	read
RD	Relative Distance	Relative distance as number {0 4095}	read
RT	RunTime	Echo run time in machine cycles [1 machine cycle = 1.085 µs]	read
SS1	Switching State 1	SS1 binary [0: inactive, 1 active] (independent of OM)	read
SS2	Switching State 2	SS2 binary [0: inactive, 1 active] (independent of OM)	read
ADB	Absolute Distance Binary	Distance in [mm] not as ASCII	read
RDB	Relative Distance Binary	Relative distance as number {0 4095} not as ASCII	read
RTB	RunTime Binary	Echo run time in machine cycles [1 machine cycle = $1.085 \mu s$] not as ASCII	read
ER	Echo Received	Echo detected: no, yes [0/1]	read
VER	VERsion	Version string: xxxx	read
ID	ID entification	ID string: P&F UC2000-F43-2KIR2-V17	read
DAT	DATe	Date string: e.g. Date: e.g. 04/12/99 Time: 11:14:35	read
ST	ST atus	Status as hexadecimal string	read
RST	ReSeT	Performs a reset	Command
DEF	DEF ault settings	Restores defaults	Command
SUC	Store User Configuration	Stores all settings	Command
RUC	Recall User Configuration	Restores stored settings	Command
	John Good Gornigaration		Johnnana

Characteristic curves/ **Additional information**

Characteristic response curves

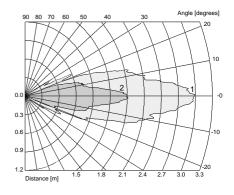

Curve 1: flat plate 100 mm x 100 mm Curve 2: round bar, Ø 25 mm

Basic setting

OM:

Relay 1: NO Relay 2: NO

SD1/SD2:

Switch point relay 1 = 100 mm Switch point relay 2 = 2000 mm

NDE/FDE:

Analogue output: $4 \text{ mA} \Rightarrow 100 \text{ mm}$

 $20 \text{ mA} \Rightarrow 2000 \text{ mm}$

FSF:

⇒ Relay 1 and 2: latest state Error

 \Rightarrow Analogue output: IouT = 3,9 mA

NEF:

No echo ⇒ error message

MA,S:

Switching mode